

## Concord 93 Park and Ride ADA summary

### 27 January 2016

### Sandt Michener

#### Accessible Parking Spaces, Main Lot:

- Van Accessible access aisle is insufficient size at 84" wide. *Add at least one van accessible space with an access aisle at least 96" wide. Post R7-8a "Van Accessible" signage mounted at least 60" high. Post "No Parking" signage on access aisle(s).*
- Spaces are missing required signage. *Provide each space with a R7-8 Accessible Parking sign.*

#### Exterior Accessible Path of Travel:

- Cracks in path of travel in excess of ½". *Repair cracks.*
- Drainage grate with openings greater than ½" in path of travel. *Relocate or replace with grate with less than ½" openings.*
- Curb ramps that transition to street are lacking detectable warning panels. *Provide detectable warning panels at curb ramps that transition into street.*

#### Women's Restroom:

- Stall door does not have a lock or handles on both sides of the door. *Provide lock and pull handles on both sides of the door.*
- Flush control is located on the wrong side. *Mount flush control on the open side of the room.*
- Horizontal grab bar is mounted at 32" high. *Mount horizontal grab bar 33-36" high.*

#### Men's Restroom:

- Horizontal grab bar is mounted at 32" high. *Mount horizontal grab bar 33-36" high.*
- Stall door does not have a lock or handles on both sides of the door. *Provide lock and pull handles on both sides of the door.*
- Coat hook is mounted at 66". *Mount coat hook no higher than 48".*
- Stall door opens into the stall. *Reverse hinges to allow door to swing out away from the stall.*

#### Drinking Fountain:

- Fountain protrudes more than 4" into the path of travel. *Provide detectable rubber mat beneath water fountain.*

#### Fire Extinguisher:

- Protrudes 6.75" into the path of travel. *Move out of path of travel or use low profile extinguisher that protrudes 4" or less.*

#### Public Telephone:

- Clear floor space of 30 x 40" for approach not provided and is in door swing. *Remove or relocate payphone to allow for 30" x 40" clear approach.*
- Operable parts are located at 60" high. *Re-mount payphone so operable parts are no higher than 48".*

#### Barriers Removed since last survey on 22 March 2013:

- Pipes beneath sink have been insulated.

- Dispensers in restroom lowered to 48" or less.

**Dover C&J Park and Ride ADA summary**  
**11 March 2016**  
**Sandt Michener**

Women's Restroom:

- Coat hook is mounted at 54" h. *Replace with new coat hook mounted no higher than 48" high.*

Men's Restroom:

- Coat hook is mounted at 54" h. *Replace with new coat hook mounted no higher than 48" high.*

Drinking Fountain:

- Fountain protrudes more than 4" into the path of travel. *Provide detectable rubber mat beneath water fountain.*

Public Telephone:

- Clear floor space of 30 x 40" for approach not provided and is in door swing. *Remove or relocate payphone to allow for 30" x 40" clear approach.*
- Operable parts are located at 52" high. *Re-mount payphone so operable parts are no higher than 48".*

Barriers removed since last survey on 12 February 2016:

- Motion sensor door opener installed.

## Exit 4 Park and Ride ADA summary

28 March 2016

Sandt Michener

### Accessible Parking Spaces:

- Van accessible parking spaces are missing appropriate signage. *Add R7-8a "Van Accessible" signage mounted at least 60" high.*

### Accessible Interior Path of Travel – Interior Doors:

- Force required to open doors up to 10 pounds. *Adjust door closer to require no more than 5 pounds of force to open door.*

### Women's Restroom:

- Coat hook is mounted at 54" h. *Replace with new coat hook mounted no higher than 48" high.*

### Men's Restroom:

- Door hardware and coat hooks are mounted at 55". *Re-mount door hardware and coat hook no higher than 48".*

### Barriers Removed since last survey on 14 Feb 2012:

- Mirrors lowered to 40".

## **Londonderry Park and Ride ADA summary**

**11 March 2016**

**Sandt Michener**

Accessible Parking Spaces – Overflow lot:

- No van accessible parking spaces. *Add at least two van accessible spaces with access aisles at least 96" wide. Two spaces may share the same access aisle. Post R7-8a "Van Accessible" signage mounted at least 60" high. Post "No Parking" signage on access aisle(s).*

Restrooms:

- Coat hooks are mounted at 63"h. *Replace with new coat hook or remount no higher than 48" high.*

Public Telephone:

- Operable parts are located at 55" high. *Re-mount payphone so operable parts are no higher than 48".*

Barriers Removed since last survey on 14 Feb 2013:

- Restroom signage updated and is now compliant.
- Sign indicating TTY is available.

**Nashua Exit 8 Rt 3 Park and Ride ADA summary**  
**14 April 2016**  
**Sandt Michener**

Exterior Accessible Path of Travel:

- Cars can pull too far forward resulting in restricted accessible path of travel. *Provide curbing to maintain access path width.*
- Signs with "Handicap" verbiage. *Replace with "Accessible" verbiage.*

Women's Restroom:

- The bottom edge of the mirror is 42" high. *Re-mount mirror so that the bottom edge is no higher than 40".*

Men's Restroom:

- The rim of the urinal is mounted at 24" high. *Mount rim no higher than 17".*
- The bottom edge of the mirror is 42" high. *Re-mount mirror so that the bottom edge is no higher than 40".*

Public Telephone:

- Clear floor space of 30 x 40" for approach not provided. *Remove or relocate payphone to allow for 30" x 40" clear approach.*

Barriers Removed since last survey on 21 February 2013:

- Detectable Rubber mat added beneath water fountain.
- Manual pull station for fire alarm now in compliance at 41".

# Portsmouth C&J Park and Ride ADA summary

## 28 March 2016

### Sandt Michener

#### Accessible Parking Spaces:

- Van accessible parking spaces are missing appropriate signage. *Add R7-8a "Van Accessible" signage mounted at least 60" high.*

#### Accessible Entrances and Exterior Doors:

- Signs are not posted at each inaccessible entrance directing individuals to the nearest accessible entrance. *Clearly post signs at each inaccessible entrance directing individuals to the nearest accessible entrance.*

#### Accessible Reception – Service Counters:

- Reception counter is 29" wide for a counter not used for writing. A counter that is used for writing should provide a 36" wide portion. *Replace or modify existing desk to conform to the aforementioned specifications.*

#### Accessible Interior Path of Travel - Obstacles:

- "Psalm" painting description protrudes 16" into the path of travel. *Remove or modify to protrude 4" or less into the path of travel.*

#### Women's Restroom:

- Coat hook is mounted at 51" h. *Replace with new coat hook mounted no higher than 48" high.*
- The pipes beneath the sink are not insulated. *Insulate pipes beneath the sink.*
- Dispensers are mounted at 52". *Mount dispensers at 48" or less.*

#### Men's Restroom:

- There are no door pull handles on the inside of the stall doors in the toilet rooms. *Install door pull handles on the inside of the stall door.*
- Door hardware and coat hooks are mounted at 51". *Re-mount door hardware and coat hook no higher than 48".*
- The pipes beneath the sink are not insulated. *Insulate pipes beneath the sink.*
- The top of the sink is 35". *Mount sink so top is no higher than 34"*
- Dispensers are mounted at 52". *Mount dispensers at 48" or less.*

## Salem Park and Ride ADA summary

15 March 2016

Sandt Michener

### Accessible Parking Spaces, Main Lot:

- Van Accessible access aisles are insufficient size at 69" wide. *Add at least one van accessible space with an access aisle at least 96" wide. Post R7-8a "Van Accessible" signage mounted at least 60" high. Post "No Parking" signage on access aisle(s).*

### Accessible Interior Path of Travel:

- Office door requires 7 pounds of force to push or pull open the door. *Adjust door closer to require 5 pounds force or less to open the door.*
- Utility door closes in less than 5 seconds. *Adjust door closer to close the door in minimum of 5 seconds.*
- Curb ramps that transition to street are lacking detectable warning panels. *Provide detectable warning panels at curb ramps that transition into street.*

### Women's Restroom:

- Coat hook is mounted at 54". *Mount coat hook no higher than 48".*
- Toilet paper dispenser is mounted 3" forward of the edge of the toilet bowl. *Mount dispenser 7-9" forward of the edge of the toilet bowl.*

### Men's Restroom:

- Coat hook is mounted at 53". *Mount coat hook no higher than 48".*

### Drinking Fountain:

- Fountain protrudes more than 4" into the path of travel. *Provide detectable rubber mat beneath water fountain.*

### Fire Extinguisher:

- Protrudes 6.75" into the path of travel. *Move out of path of travel or use low profile extinguisher that protrudes 4" or less.*

### Public Telephone:

- Clear floor space of 30 x 40" for approach not provided and is in door swing. *Remove or relocate payphone to allow for 30" x 40" clear approach.*
- Operable parts are located at 54" high. *Re-mount payphone so operable parts are no higher than 48".*

### Barriers Removed since last survey on 21 February 2013:

- Auto flush installed at accessible urinal.